
Vehicle Inspection Report


wscars-importation.com







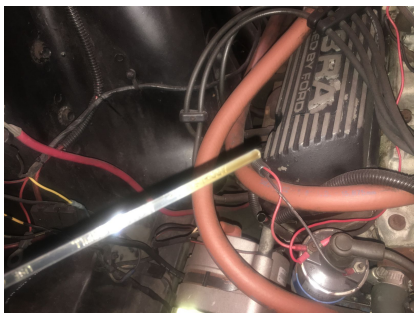















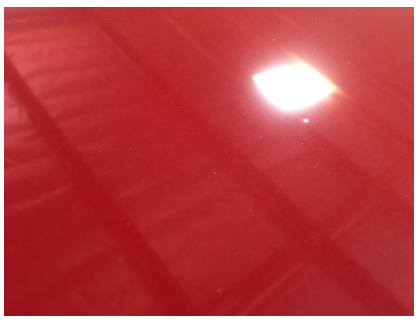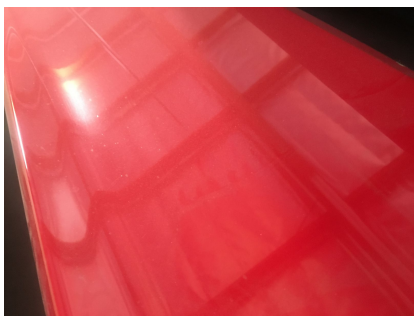

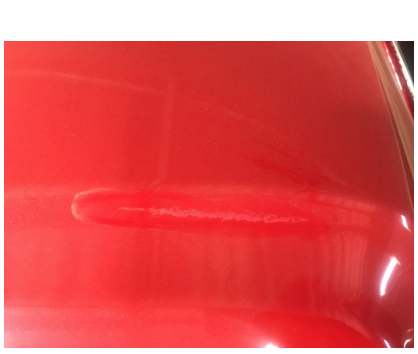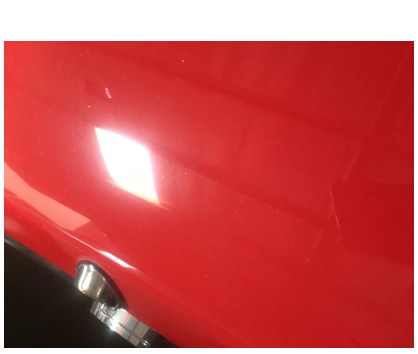

www.uscarsimportation













65/6588
































California
WLP198





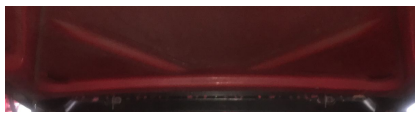

BFGoodrich

BFGoodrich






















































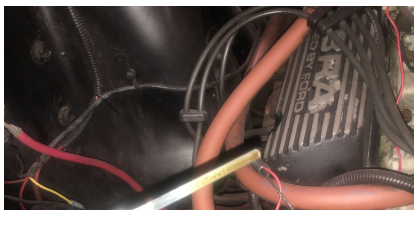



www.classic-imports.com

Summary

This 1965 Ford Mustang is in fair running and driving condition with some issues of note. This car is considered to be in fair driver quality needing some work and is not a show car. This car would be a good candidate for a complete restoration. The hood, doors, and trunk lid are all slightly misaligned. The rear passenger side of the roof has heavy scuffing. There are minor misc nicks and scratches around the vehicle, most of which are too small to see in pics. The repaint quality is poor with all panels having fish eyes and dirt in the paint, hard to capture in a photo but easily seen in person. The driver's door seal is torn. The front center lights are disconnected and the right rear turn signal is not working. The driver's mirror is loose and does not hold its position. There is paint overspray on the chrome bumpers. I checked the vehicle with a magnet and found it to stick all around but was weaker in the lower panels. Not excessive. There are some scrapes and dents in the lower rocker panels. There is some body-rot in the inner trunk to quarter panel wells and will need some metal work. There is paint overspray on the chrome in various places. The chrome is showing age with fading, scratches, and pitting. The horn does work but the button is loose. There are minor snags on passenger front lap belt, within normal wear limits, does not affect function or safety. The radio does not work. The inner door panels show minor wear and separation at the interior handles. The dash lights are not working. All carpets show stains. The floor mats are stained. The rear of the headliner is sagging, separating, and stained. There are minor scratches and gouges in both rear side panels. The interior trim shows normal wear consistent with age and mileage otherwise. Both front windows show alignment issues, front passenger window is stiff to roll down, rear passenger window does not work and not fully closed. The wheels are in good condition with no notable damage and the tires are old and dry rotted and will need immediate replacement. The coolant reservoir is missing the cap. The engine coolant was low. The belt is showing wear and cracking from age. The power steering system has a leak. The area should be cleaned off and rechecked to find the source of the leak. The power steering fluid is low. The power steering fluid is low. The engine shows active oil leaks. The engine should be pressure washed off and rechecked to verify the source of the leak or all leaks. The transmission is leaking fluid to a drip from the underside. This area should be cleaned off to determine the source of the leak. The set screw for the brake reservoir cover was overtightened, unable to verify fluid level. The rear differential is leaking fluid. All ball joint boots are cracked or torn. There are several aftermarket chrome pieces installed under the hood. The owner would not allow a test drive to be completed. Due to this, I spent more time going over the the vehicle. I found the engine to start and run well. The transmission engaged in both forward and reverse but did seem difficult to engage in gear and may need clutch work. The brakes were firm, and held the vehicle properly. Please see photos and below for more info.

www.uscarsimportation.com

VEHICLE INFO	
Year	1965
Make	Ford
Model	Mustang
VIN	5R07C126588
Stock No.	6588
Mileage	28272
Transmission	Manual
Drive Type	Rear Wheel Drive
Engine Size	8 Cylinder
Fuel Type	Gas
Exterior Color	Red
Interior Color	Tan
Interior Material	Other

EXTERIOR	
Wiper Blades	
Body Panel Alignment	The hood, doors, and trunk lid are all slightly misaligned.
Scratches	The rear passenger side of the roof has heavy scuffing. There are minor misc nicks and scratches around the vehicle, most of which are too small to see in pics.
Dings	
Dents	
Paint Condition	The repaint quality is poor with all panels having fish eyes and dirt in the paint, hard to capture in a photo but easily seen in person.
Seals	The driver's door seal is torn.
Rust	
Body Filler Used	I checked the vehicle with a magnet and found it to stick all around but was weaker in the lower panels. Not excessive.
Exterior Lights	The front center lights are disconnected and the right rear turn signal is not working.
Power Door Mirrors	The driver's mirror is loose and does not hold its position.
Bumpers	There is paint overspray on the chrome bumpers.
Underbody/Frame Condition	
Glass	
Chrome	There is paint overspray on the chrome in various places. The chrome is showing age with fading, scratches, and pitting.

www.uscars-importation.com

EXTERIOR	
Doors	
Hood	
Quarter Panels	
Rockers	There are some scrapes and dents in the lower rocker panels.
Floors	

INTERIOR	
Steering Wheel	
Horn	The horn does work but the button is loose.
Seat Condition	
Seat Belts	There are minor snags on passenger front lap belt, within normal wear limits, does not affect function or safety.
Radio/Navigation/DVD	The radio does not work.
Inner Door Panels	The inner door panels show minor wear and separation at the interior handles.
Window Function	Both front windows show alignment issues, front passenger window is stiff to roll down, rear passenger window does not work and not fully closed.
Dash	
Dash Lights Working	The dash lights are not working.
Heater	
Carpet	All carpets show stains.
Floor Mats	The floor mats are stained.
Signs of Smoking?	
Headliner	The rear of the headliner is sagging, separating, and stained.
Blower Motor	
Instrument Cluster/Gauges	
Air Filter	
Unusual Odors	
Sun Visors	
Interior Trim	There are minor scratches and gouges in both rear side panels. The interior trim shows normal wear consistent with age and mileage otherwise.
Modifications	There are several aftermarket chrome pieces installed under the

www.uscars-importation.com

INTERIOR	hood.
Inner Trunk Condition	There is some body-rot in the inner trunk to quarter panel wells and will need some metal work.

MECHANICAL	
Battery Condition	
Charging System	
Cooling Fan Condition Mechanical/Electronic	
Radiator Cap Sealing Properly	The coolant reservoir is missing the cap.
Hoses and Clamps Age/Cracking	
Radiator Condition	
Engine Coolant Condition	The engine coolant was low.
Coolant Leaks	
Belts	The belt is showing wear and cracking from age.
Power Steering System	The power steering system has a leak. The area should be cleaned off and rechecked to find the source of the leak.
Power Steering Fluid Condition	The power steering fluid is low.
Engine Oil Condition	
Engine Oil Leaks	The engine shows active oil leaks. The engine should be pressure washed off and rechecked to verify the source of the leak or all leaks.
Transmission Fluid Leaks	The transmission is leaking fluid to a drip from the underside. This area should be cleaned off to determine the source of the leak.
Brake System Condition	The set screw for the brake reservoir cover was overtightened, unable to verify fluid level.
Brake Fluid Leaks	
Differential leaks	The rear differential is leaking fluid.
Muffler System	
Shocks and bushings Condition. Leaking?	
Ball Joints and Tie Rods	All ball joint boots are cracked or torn.

ROAD TEST	
Engine Starting Easily	
Braking Performance	
Suspension Performance	

TIRE MANUFACTURER	

www.uscars-importation.com

Driver Front	BF Goodrich
Passenger Front	BF Goodrich

Driver Rear	BF Goodrich
Passenger Rear	BF Goodrich
TIRE SIZE	
Driver Front	P215/70/R14
Passenger Front	P215/70/R14
Driver Rear	P215/70/R14
Passenger Rear	P215/70/R14
TIRE CONDITION	
Driver Front	Dry Rot, Uneven Wear
Passenger Front	Dry Rot, Uneven Wear
Driver Rear	Dry Rot, Uneven Wear
Passenger Rear	Dry Rot, Uneven Wear
WHEEL CONDITION	
Driver Front	No Issues
Passenger Front	No Issues
Driver Rear	No Issues
Passenger Rear	No Issues
TIRE TREAD	
Driver Front	8/32
Passenger Front	8/32
Driver Rear	8/32
Passenger Rear	8/32
SPARE TIRE	
Spare Tire Yes or No	Yes

www.uscars-importation.com



10/32 OR MORE

Tires have plenty of tread!
(standard)

8/32 OR MORE

Tires have plenty of tread!
(low profile)

5/32 TO 7/32

Tires will need replacement soon!

4/32 OR LESS

Tires need replacement!

www.uscars-importation.com

ACCREDITED BUSINESS · AUTOMOTIVE SERVICE EXCELLENCE · AutoCheck from Experian

US CARS Importation